

Miller Dynasty/Maxstar Welding Cart Instructions.


Please read these instructions thoroughly before welding your cart. If you need further instruction you can download the 3D models by visiting the "Instructions and 3D models" page on All-a-cart.com

Proper PPE is recommended at all times. Safety glasses, gloves, hearing protection, and/or a welding helmet when necessary. Sheet metal edges may be sharp. Handle with caution.

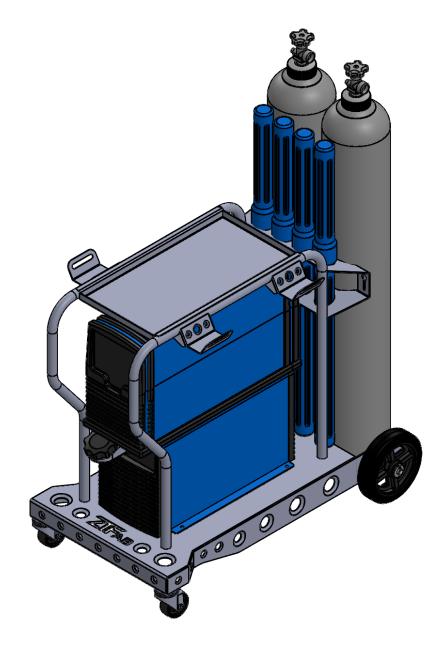


ITEM NO.	PART NUMBER	Standard QTY
1	WC-Handle Tube	2
2	WC-Base]
3	WC-Bottle Base	1
4	WC-Axle Bracket	1
5	WC-Cord Hangers	Optional
6	WC-Sides	2
7	WC-Axle Shaft	2
9	WC-Bottle Bracket_TRH	1

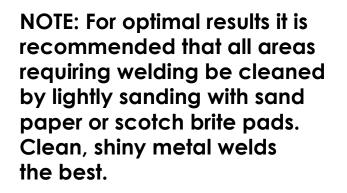

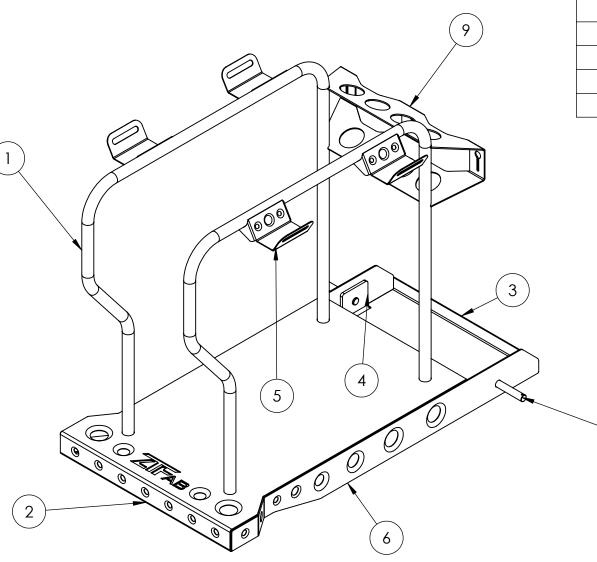

Step 1: Base Sides

Position Side plates onto cart base. A square or 90* corner magnets will help in lining up the edges.

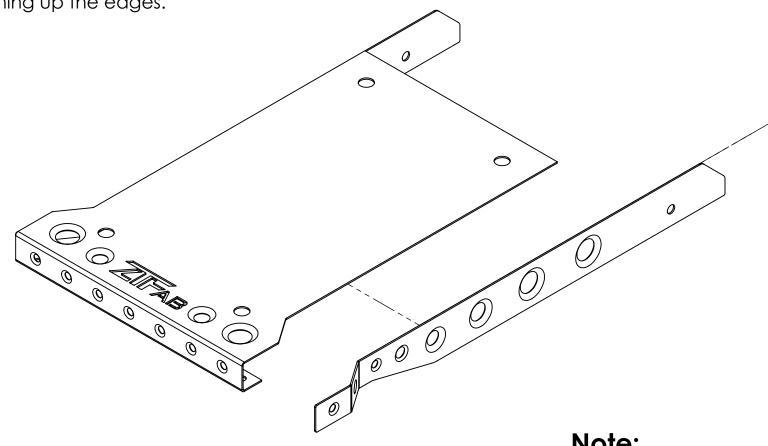

Note:

Lightly Sand all edges that need to be welded for best quality. Being careful not to remove excessive material.

Step 1A:

DETAIL A

SCALE 1:2

Tack weld sides to base incrementally to ensure proper corner fit-up. Position tack welds every 2-3 inches to help keep distortion to a minimum. Sides should be 90* to the top of the cart base.

 \bigcirc

 $(\cap$

AR C

Ø

 \bigcirc

NOTE:

Ø

Q O

0


 \bigcirc

Due to the Dimple Die Forming of the side panels they may be slightly curved. It may be easiest to start with the front corner, position and tack weld it first, then use a large clamp or clamps and work your way to the back, aligning, fitting, and tacking along the way.

 \bigcirc

0

Fit-up should be an "Open Corner" joint.

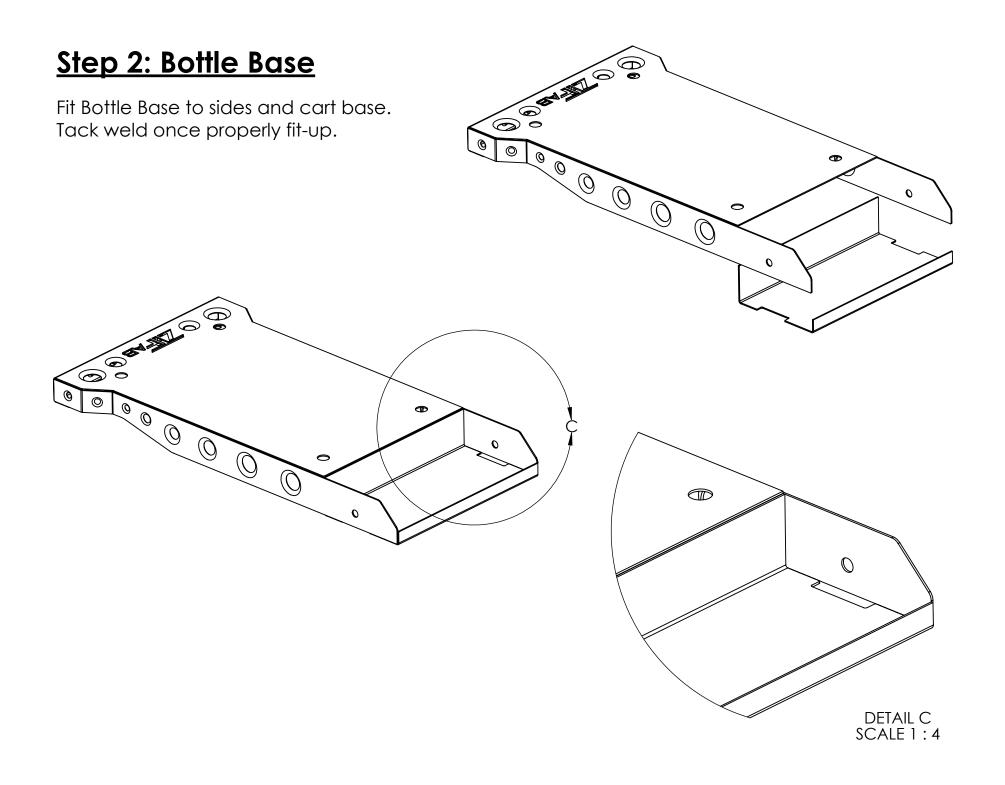



Step 3: Axle Bracket

Position the axle bracket into the slots of the bottle base. Align the axle holes and tack weld into place. TIP: Use the axle shafts or some bolts to keep the holes aligned.

0

0

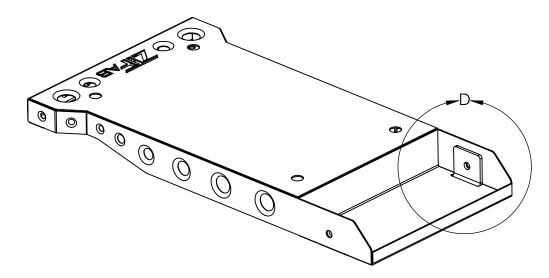

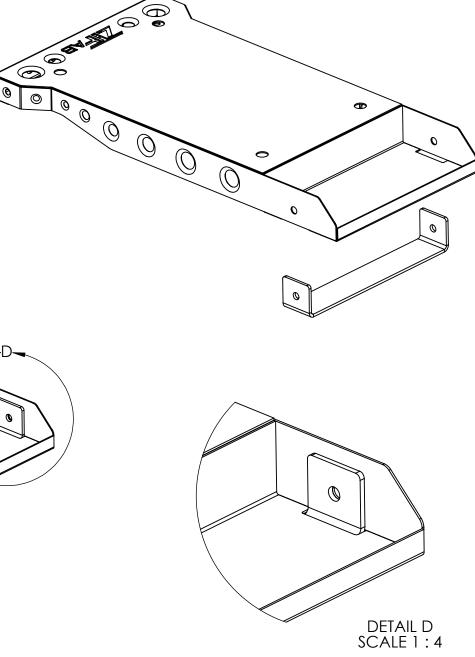


Step 4: Welding the Base


Weld the parts of the base together using your preferred method of welding. Alternate your welds to keep distortion to a minimum.

NOTE: If you are not comfortable with welding the outside corner joints of the base, you can weld the side plates to the base from the inside instead.


0

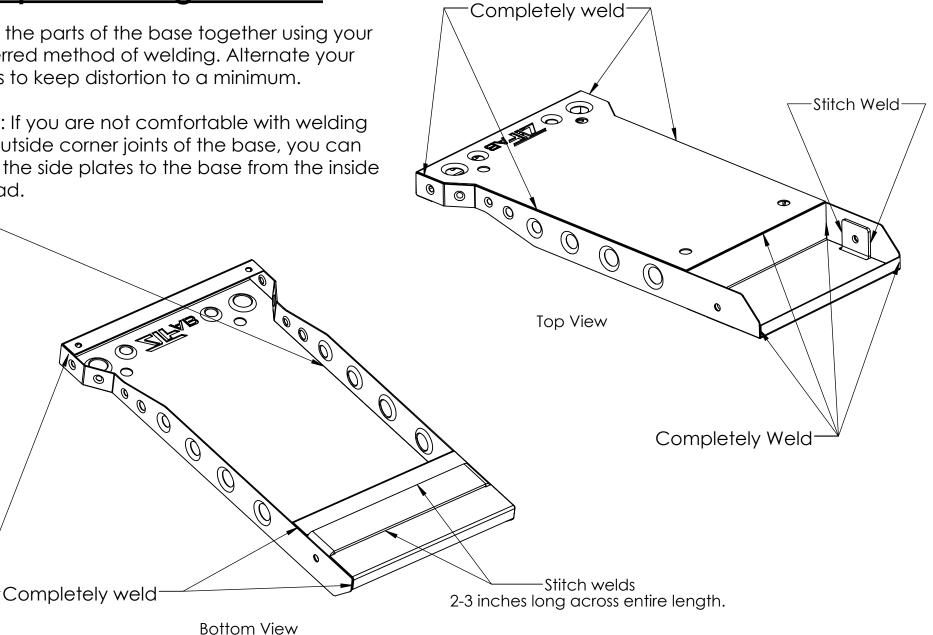

Step 5: Positioning Tubes

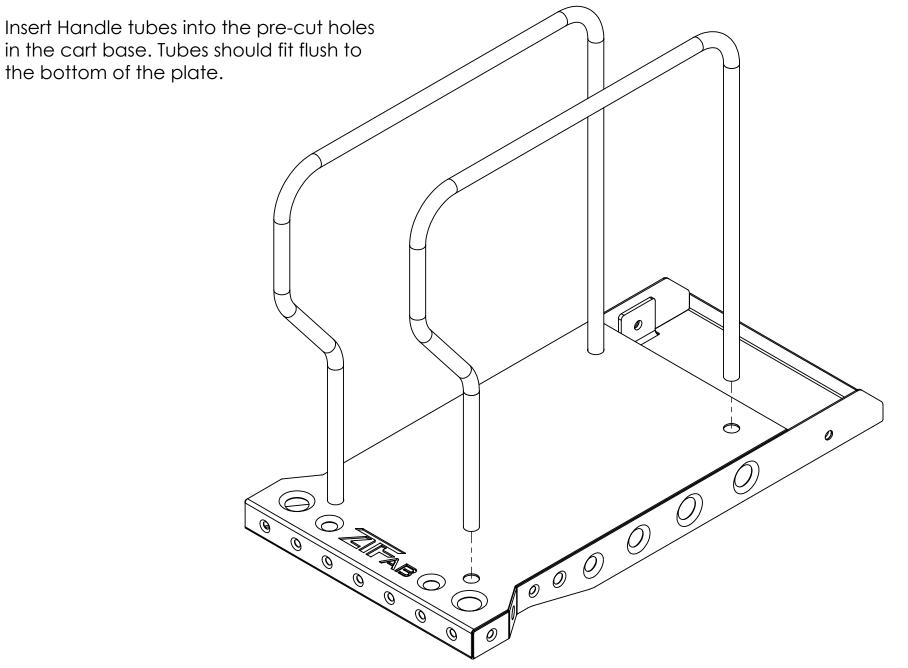


Step 5A: Tacking Tubes

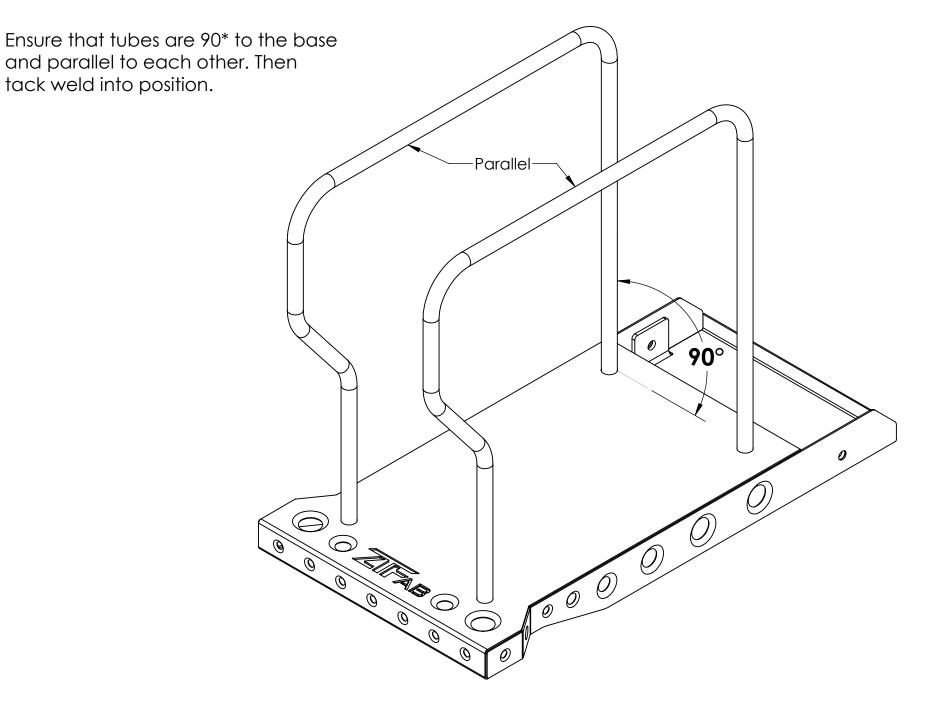


Step 6: Bottle Bracket

Position the Bottle Bracket onto the tubes. Height on tubes will be determined by the size of your bottles. Pay close attention to the position of the chain slots. Make sure the Large opening is at the top. Tack weld the bracket to the tubes.

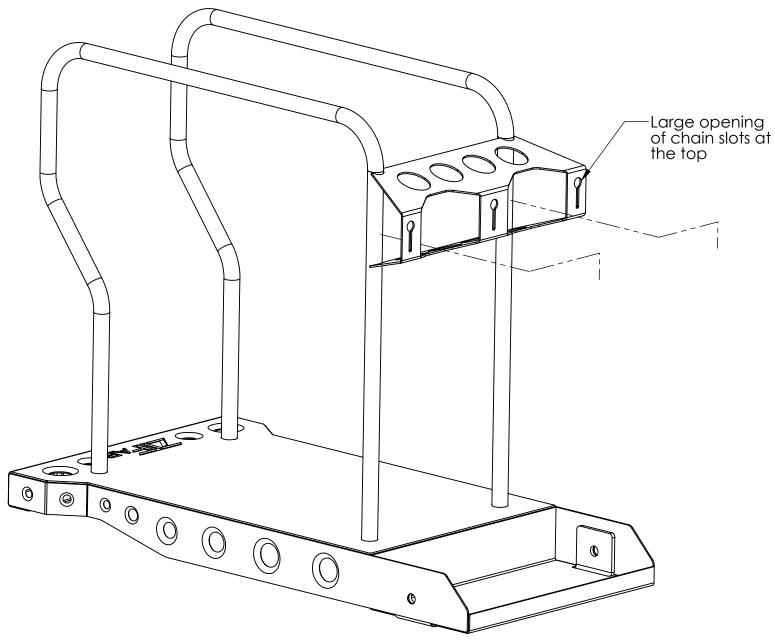

Step 7: Cord and Accessory hangers


Place the cord hangers and/or foot pedal holder on the tubes. The placement of these items is completely to your preference.

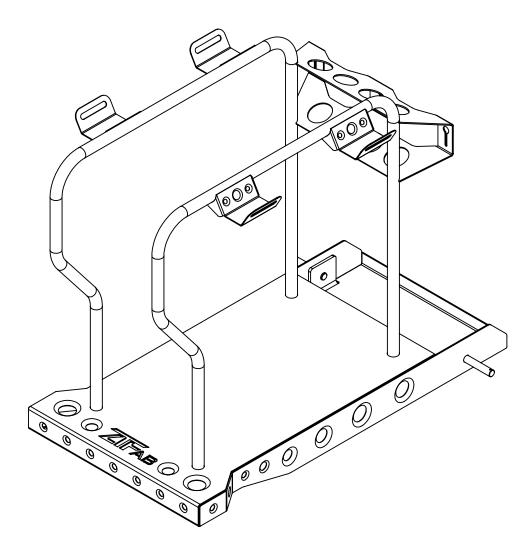

Step 8: Axle Shafts


Place the axle shaft throught the sides of the base and into the axle bracket. The axle should protrude through the axle bracket 1/8"-1/4" depending on the wheel used. If necessary, use the wheel with any spacers or washers required to ensure proper depth.

Make sure the axles are parallel to the ground and 90* to the cart sides and tack in place. DO NOT PLACE ANY TACK WELDS OR FINAL WELDS ON THE OUTSIDE OF THE AXLE SHAFTS.

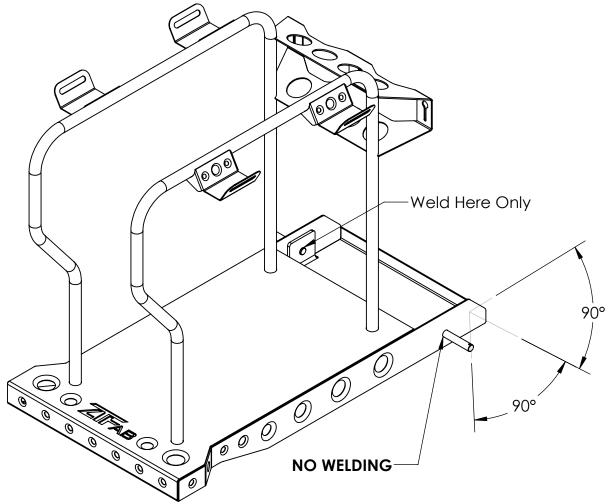

Step 9: Final Welding

Ensure that all brackets, tabs, and parts are securely tack welded in their proper locations. Complete all welds as necessary.

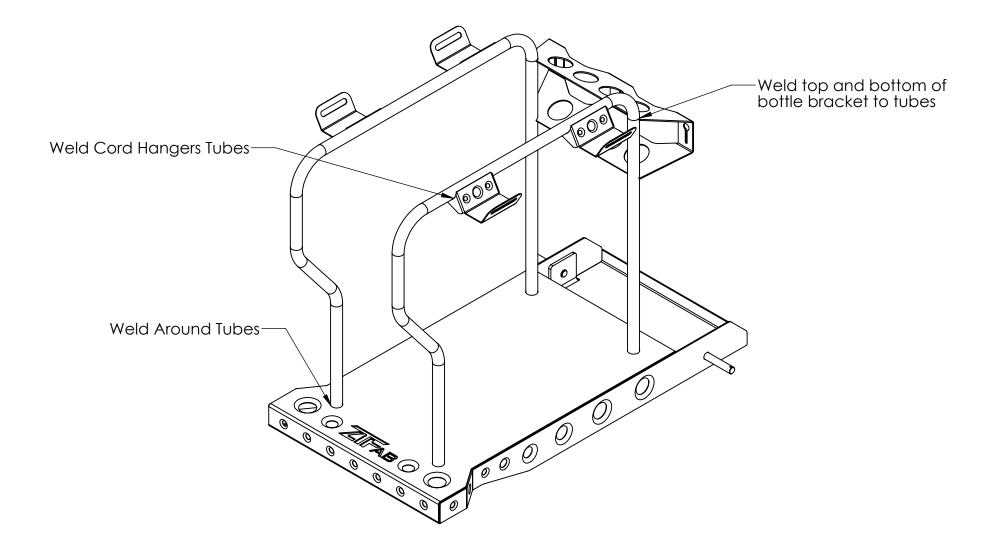

Step 10: Assembly

After you have test fit your welder, bottles, all accessories, and applied your preferred method of protection (i.e., paint, powder coat, etc) install the front casters and rear wheels with the supplied hardware. Attach the bottle chains to the bottle bracket by inserting the ends into the Key holes.

